



---

## SM12DP2XA Release Notes

**Date: Jun.9 2020**

**Version: 7.10.2544**

---

### Overview

This release notes covers firmware version v7.10.2544 and MIB for SM12DP2XA

### Release Changes and Enhancements

#### [New Features & Changes]

---

- \* Set the value of timeout WEB GUI
- \* Modify System Information Name display requirement.
- \* modify topology view right side function key design.
- \* Add Click Save Button when Save Start Button on Web UI.

#### [Bugs Fixed]

---

- \* 10G: When switch port speed mode set to 10G FDX then use 10G(DAC-10G-SFP-01M) cable to connect other 10G switch port (10G FDX mode), the link will fail.
- \* VLAN: vlan membership information and selection are inconsistent on WEB and CLI.
- \* CLI: When idle time (auto logout time) is reached, Web page does not automatically go to login screen.
- \* Syslog: The first syslog sent by the switch is incorrect.
- \* TACACS: Set telnet auth method to tacacs, then login through telnet, the "show logging" still display local method.
- \* Web: After the user login and logout, the auto logout time does not return to default value (10min).
- \* CLI: Performing the "no hostname" command, the hostname does not restore to default.
- \* CLI: redundant "show dhcp" command executable.
- \* Switch cannot issue DHCP IP other than VLAN 1.
- \* Web: Modifying the System name will change to the Model Name on the left
- \* LLDP: Management Address value of the LLDP packet is MAC, not IP address.

### Known Limitations and Restrictions

- 1- On the SM12DP2XA, Rapid Ring roles cannot be returned to Disable using the Web GUI. The roles can be disabled using the CLI command interface.
- 2- Web timeout has issue with timeout set greater than 10 minutes